

AF05.20-U-1400AG	Short, loud rattling noise audible during cold start only, on left or right side in camshaft adjuster	14.4.97
------------------	---	---------

ENGINE 119.970 12 as of 029923 as of 1.11.92,
119.971 12 as of 015069 as of 1.11.92,
119.972 12 as of 002097 as of 1.11.92,
119.974 12 as of 006973 as of 1.11.92,
119.975 12 as of 007964 as of 1.11.92

Damage code	Cause	Remedy	
	The oil check valve is leaking. Oil drains from camshaft timing adjusters and oil filter housing	Remove oil filter housing and install repair kit with modified check valve: for Models: 124 and 210 for Model: 129 for Model: 140	ra180a1191100x ra180b1191100x ra180c1191100x

Parts ordering note

Part no.	Designation	Quantity
119 184 01 30	Repair kit with modified check valve	1