

AF05.20-P-1400EG	Short, loud shattering noise, only audible following cold start on left or right in camshaft adjuster	1.9.92
------------------	---	--------

ENGINE 119.970 #2 up to 029922,
119.971 #2 up to 015068

in MODEL 140

ENGINE 119.972 #2 up to 002096 in MODEL 129

ENGINE 119.974 #2 up to 006972,
119.975 #2 up to 007963

in MODEL 124

Modification notes

1.12.97	References changed		
---------	--------------------	--	--

Damage code	Cause	Remedy:	
18 101 04	Oil filter return flow valve leaky. Oil drains out of camshaft adjuster and oil filter housing.	1 Remove/install oil filter housing.	ra180a1191100x ra180b1191100x ra180c1191100x
		2 Install return flow valve repair kit.	

Parts ordering note

Designation	Quantity	Part no.
Return flow valve repair kit	1	119 184 01 30